

Remote Monitoring for Business



ALTA® Wireless Advanced Vibration Meter

General Description

<u>ALTA® Wireless Advanced Vibration Meters</u> use a tri-axis accelerometer and temperature sensor to monitor system vibration health.

Key Features

- Three-axis measurement:
 - Acceleration root mean square (RMS), Velocity (RMS), Displacement, or Acceleration Peak
 - Frequency
 - Crest Factor
- Measures Duty Cycle and Temperature
- Configurable Frequency Range
- Configurable Hanning filter
- Measure up to 4200 Hz / 252,000 RPM
- Configurable measurement interval as low as 1 second
- Configurable thresholds for critical condition monitoring

Principles of Operation

The ALTA Wireless Advanced Vibration Meter uses an accelerometer to measure a suite of tri-axis vibration data in addition to sensor duty cycle (a percentage of activity) and temperature. It reports this data on a user-configurable time interval or Heartbeat. In addition, the sensor can report the current, max, or average data. These measurements are sent to the gateway, making the data available in iMonnit or another approved data service.

Example Applications

- Vibration monitoring for nearly anything
- Motor, pump, system door, and fan monitoring
- Smart machines, structures, and materials monitoring
- Wind turbine and utility pole monitoring
- Assembly line monitoring
- Air conditioner and heat pump monitoring
- Additional applications

Features of Monnit ALTA Sensors

- Wireless range of 2,000+ feet through 18+ walls¹
- Frequency-Hopping Spread Spectrum (FHSS)
- · Best-in-class interference immunity
- Best-in-class power management for longer battery life²
- Encrypt-RF® Security (Diffie-Hellman Key Exchange + Advanced Encryption Standard (AES)-128 Cipher Block Chaining (CBC) for sensor data messages)
- Sensor logs 2000 to 4000 readings if the gateway connection is lost (non-volatile flash, persists through power cycling):
 - 10-minute Heartbeats = ~ 22 days
 - 2-hour Heartbeats = ~ 266 days
- Automatic over-the-air updates to sensor firmware (future-proof)
- Free iMonnit Basic Online Wireless Sensor Monitoring and Notification System to configure sensors, view data, and send alerts via SMS text, email, and voice call
 - 1 Actual range may vary depending on the environment and gateway.
 - 2 Battery life is determined by the sensor reporting frequency and other variables. Other power options are also available.

Wireless Range Comparison



Technical Sp	pecification ALTA®	Wireless Advanced \	/ibration Meter		
Accelerometer	Vibration Variation over Temperature		0.01 %/°C (0.018%/°F)(xy), 0.03 %/°C (0.054%/°F)(z)		
	Cross Axis Sensitivity		2%		
	General Noise ¹	RMS	0.7 mg		
		Density	130 μg/√(SampleRate)		
	Transducer Type		10 KOhm NTC Thermistor (β = 3455 K)		
T	Calibrated accuracy		± 1°C (±1.8°F)		
Temperature	Resolution		0.1°C (0.18°F)		
	Response time		50 seconds (10 second time constant) ²		
	Dimensions		0.75" x 0.75" x 0.75"		
	Weight		17g (cube with electronics and epoxy)		
Cuba	Mounting Hole		M4 x 0.7 Tapped Threads, 7mm hole depth		
Cube	Composition		Aluminum and accelerometer potted with black epoxy		
	Operating Temperature		-40°C to 105°C (-40°F) to 221°F) (Electronics only)		
	Operating Humidity		0 to 100% (Electronics sealed inside)		
	Wire details		6-conductor, 28 AWG, stranded copper		
	Operating Temperature		-25°C to 85°C (-13°F to 185°F)		
	Length		3 m (10 ft)		
	Insulation / Jacket		PVC (black), 0.010"		
اممط	Shield		Yes		
Lead	Overall Diameter		4.5 mm (0.177")		
	Ratings / Approvals		UL AWM STYLE 2464, cUL AWM I/IEC RoHS/Reach Compliant		
	Temperature Rating		-20°C to 85°C (-4°F to 185°F) ³		
	Voltage Rating		300 V Max		
	Dielectric Strength		1500 V RMS		
	Data logging		Sensor logs 2000 to 4000 readings if gateway connection is lost (non-volatile flash, persists through power cycling): 10-minute Heartbeats = ~22 days - 2-hour Heartbeats = ~266 days		
ALTA	Wireless protocol		ALTA Proprietary Frequency-Hopping Spread Spectrum (FHSS)		
Wireless	Wireless transmission power (EIRP)		50 mW (900MHz), 25 mW (868 MHz), 10 mW (433 MHz)		
	Wireless range		2,000+ ft. through 18+ walls with the ALTA XL® Gateway		
	Security		Encrypt-RF® (256-bit key exchange and AES-128 CTR)		
	Battery voltage range		2.0 to 3.8 VDC		
General	Operating altitude (non-pressurized environments)		-15.2 to 1,982 m (-50 to 6,500 ft) ⁴		
	Storage altitude (non-pressurized environments)		-15.2 to 3,048 m (-50 to 10,000 ft) ⁴		
	Operating humidity		5 to 85% RH (non-condensing)		
	Certifications FC Industry Canada	CE CA	900 MHz sensors: FCC ID: ZTL-G2SC1 and IC: 9794A-G2SC1. 868 and 433 MHz sensors tested and comply with: EN 55032: 2015/A11:2020; EN 55035:2017/A11:2020; ETSI EN 300 220 V3.2.1 (2018-06); ETSI EN 301 489-3 V2.2.0. (2021-11); and ETSI EN 303 645. All sensors tested and comply with: EN 61010-1 and EN 60950 and meet RoHS 2015/863 and REACH		

Noise increases as sample rate increases. Noise spikes of 2000 mm/s^2 are not uncommon when measuring at 12800 Hz sample rate. See Response time defined as five time constants for 99.3% of actual temperature.

Temperatures colder than the rating are acceptable if the cable is not moving or vibrating.

Operating and storage altitude without DC power supply is -30.48 to 9144 m (-100 to 30000 ft).

Data Specifications					
Data	Range	Resolution	Accuracy		
Frequency ¹	(X,Y) 0.4 Hz to 4200 Hz (Z) 0.4 Hz to 2900 Hz	0.1 Hz	+/- (0.2 Hz + 2% of Reading)		
Acceleration Peak	0 to 156912 mm/s^2 ⁵	10 mm/s^2	Typical: +/- 10% of Reading ²		
Acceleration RMS	0 to 110954 mm/s^2 ⁵	10 mm/s^2	Typical: +/- 10% of Reading ²		
Velocity RMS	0.00 to 655.36 mm/s ^{4,5}	0.01 mm/s	Typical: +/- 15% of Reading ^{2,3}		
Displacement Peak to Peak	0.00 to 655.36 mm p-p ^{4,5}	0.01 mm	Typical: +/- 20% of Reading ^{2,3}		
Crest Factor	0.00 to 3.95	0.02	Typical: +/- 10% of Reading		
Duty Cycle	0 to 100%	1%	Varies ⁶		
Temperature 0.0°C to 125.0°C		0.1°C	+/- 1°C		

- 1. The range is configuration dependent. See the Frequency Measurement Range table for full characterization of the frequency range.
- 2. Accuracy may vary with frequency of signal. See footnotes under Frequency Measurement Range table for more information on this variation.
- 3. Velocity and Displacement are derived from acceleration and frequency so they tend to be less accurate than direct acceleration measurements.
- 4. Velocity and Displacement ranges are inversely related to frequency. So, for the same acceleration signal these values will increase as frequency decreases. General Velocity = Acceleration / (2*Pi*Freq), General Displacement = Acceleration / (2*Pi*Freq)^2. The user software configurable Bandwidth of the sensor affects the practical range possible.
- 5. Acceleration Range is user software configurable to 2, 4, 8, or 16 G. This affects the practical range possible.
- 6. Duty Cycle resolution and accuracy will vary based on measurement interval and Heartbeat configurations. Refer to the description of Duty Cycle for more information.

Accurate Frequency Measurement Range ³						
	ACC RMS/AccPeak		Velocity		Displacement	
Sample Rate (Hz)	Min Freq (Hz)	Max Freq (Hz)	Min Freq (Hz)	Max Freq (Hz)	Min Freq (Hz)	Max Freq (Hz)
12800	200	4200 ^{1,2}	300	4800	400	4800
6400	100	2400	150	2400	200	2400
3200	50	1200	75	1200	100	1200
1600	25	600	37.5	600	50	600
800	12.5	300	18.75	300	25	300
400	6.25	150	9.375	150	12.5	150
200	3.125	75	4.6875	75	6.25	75
100	1.5625	37.5	2.34375	37.5	3.125	37.5
50	0.78125	18.75	1.171875	18.75	1.5625	18.75
25	0.390625	9.375	0.5859375	9.375	0.78125	9.375


- 1. On the X and Y axes, above 3200 Hz the sensor experiences gradual signal loss reaching -3 dB at ~4200 Hz. Above 4200 Hz the loss increases rapidly. Do not recommend using sensor with signals above 4200 Hz. On the Z axis, above 2000 Hz, the sensor experiences gradual signal loss reaching -3 dB at ~2900 Hz. We do not recommend using the Z-axis with signals above 2900 Hz.
- 2. On the X and Y axes, between 1000 Hz and 3200 Hz the sensor may experience a gradual signal increase peaking at about 2 dB at ~2000 Hz then returning to no increase at ~3200 Hz. On the Z axis this increase occurs between 1000 Hz and 2100 Hz and is usually below 2 dB. This increase generally peaks at ~1700 Hz.
- 3. The measurement range is configurable. The software will default to the most accurate range when the Sample Rate or Vibration Mode is changed, but manually adjusting above and below these limitations is possible via the software UI.

Typical RMS Noise				
	Power Mode			
Sample Rate	High	Medium	Low	Units
12800	1007	1007	1007	mm/s^2
6400	507	507	507	mm/s^2
3200	257	257	257	mm/s^2
1600	132	132	132	mm/s^2
800	70	70	70	mm/s^2
400	38	64	104	mm/s^2
200	23	41	68	mm/s^2
100	15	29	51	mm/s^2
50	11	23	42	mm/s^2
25	9	20	38	mm/s^2

Typical Peak Noise					
	Power Mode				
Sample Rate	High	Medium	Low	Units	
12800	2010	2010	2010	mm/s^2	
6400	1010	1010	1010	mm/s^2	
3200	510	510	510	mm/s^2	
1600	260	260	260	mm/s^2	
800	135	135	135	mm/s^2	
400	73	119	188	mm/s^2	
200	41	72	118	mm/s^2	
100	26	48	83	mm/s^2	
50	18	37	65	mm/s^2	
25	14	31	56	mm/s^2	


Sensor Data				
Data	Presentation	Description		
Data Mode	Most Recent, Max, or Average	The data mode of the sensor at the time the data point is produced.		
Frequency	Frequency is calculated by running the sampled acceleration data through an FFT and then finding the largest peak energy in that data set within the configured bandwidth for the configured vibration type.			
Fundamental Frequency	X: xxxx.x Hz	The frequency within the configured bandwidth with the most vibration energy.		
Fundamental Frequency	Y: xxxx.x Hz	The frequency within the configured bandwidth with the most vibration energy.		
Fundamental Frequency	Z: xxxx.x Hz	The frequency within the configured bandwidth with the most vibration energy.		
Vibration	The Vibration mode is configurable to Acceleration, Velocity, or Displacement. The meter or sensor will only product data in the mode selected. The sensor takes 256 acceleration samples per axis, every measurement at the configurable rate, to reproduce the vibration waveform for analysis. Using this waveform, and in some cases an FFT, the sensor calculates the vibration.			
Mode: Acceleration				
Acceleration Peak	X: xxxxxx mm/s^2	The peak acceleration in the time domain.		
Acceleration Peak	Y: xxxxxx mm/s^2	The peak acceleration in the time domain.		
Acceleration Peak	Z: xxxxxx mm/s^2	The peak acceleration in the time domain.		
A 1 (' DMC	· / / / /			
Acceleration RMS	X: xxxxxx mm/s^2	The combined RMS total of all acceleration energy within the configured bandwidth.		
Acceleration RMS (Y-Axis)	Y: xxxxxx mm/s^2	The combined RMS total of all acceleration energy within the configured bandwidth.		
Acceleration RMS (Y-Axis)	Z: xxxxxx mm/s^2	The combined RMS total of all acceleration energy within the configured bandwidth.		
Mode: Velocity RMS				
Velocity RMS (X-Axis)	X: xxx.xx mm/s	The combined RMS total of all velocity energy within the configured bandwidth.		
Velocity RMS (Y-Axis)	Y: xxx.xx mm/s	The combined RMS total of all velocity energy within the configured bandwidth.		
Velocity RMS (Y-Axis)	Z: xxx.xx mm/s	The combined RMS total of all velocity energy within the configured bandwidth.		
Mode: Displacement p-p				
Displacement (X-Axis)	X: xxx.xx mm p-p	The combined RMS total of all displacement energy within the configured bandwidth converted to a peak to peak value.		
Displacement (Y-Axis)	Y: xxx.xx mm p-p	The combined RMS total of all displacement energy within the configured bandwidth converted to a peak to peak value.		
Displacement (Z-Axis)	Z: xxx.xx mm p-p	The combined RMS total of all displacement energy within the configured bandwidth converted to a peak to peak value.		
The Peak Acceleration / RMS Acceleration. The typical value for a perfect sinusoidal vibration waveform this value increases above 1.41, it is a sign that non-fundamental vibrations are contributing to the overa and machine health may be declining. Conversely, if the value is below 1.41, it is a sign there is clipping vibration signal, which means the vibration signal may be greater than the G-range configuration of the si		pove 1.41, it is a sign that non-fundamental vibrations are contributing to the overall vibration, ay be declining. Conversely, if the value is below 1.41, it is a sign there is clipping of the		
Crest Factor (X-Axis)	X: x.xx	The peak acceleration / RMS acceleration. (Unitless since it is a ratio)		
Crest Factor (Y-Axis)	Y: x.xx	The peak acceleration / RMS acceleration. (Unitless since it is a ratio)		
Crest Factor (Z-Axis)	Z: x.xx	The peak acceleration / RMS acceleration. (Unitless since it is a ratio)		
Duty Cycle	The Duty Cycle is the percentage of time since the previous Heartbeat that the vibration level, in Gs, was above the Sensitivity Threshold configuration. The sensor calculates this percentage in conjunction with the Measurement Interval configuration. For example, if the Measurement Interval is 6 seconds and the Heartbeat is 1 minute, there will be up to 10 measurements per Heartbeat. If 7 of these 10 measurements detect vibration levels on any axis or combination of axes above the Sensitivity Threshold, then the Duty Cycle will be 70%.			
Duty Cycle (All Axes)	xxx %	The percent indicates how much of the Heartbeat vibration was present.		
Temperature	A temperature-sensing element embedded in the cube measures the temperature of the electronics in the cube.			
Temperature xxx.x° C The temperature of the cube.		The temperature of the cube.		
. c. iiporataro	,,,,,,, O	sp.sidiai o s. iiio odao.		

^{1.} All units are the default units for the sensor. Units are configurable via software.

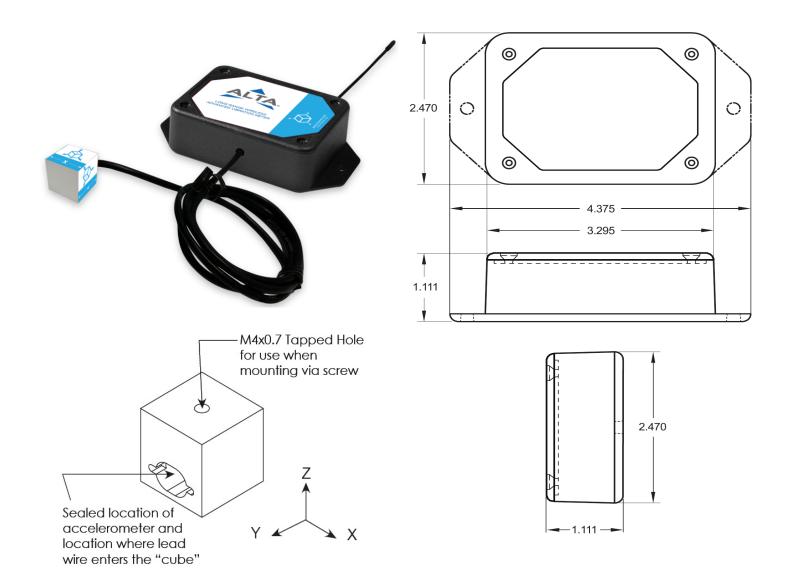

Technical Specifications ALTA® Enterprise			
Battery ¹	2x 1.5V AA Alkaline, 1500 mAh, (standard) 2x 1.5V AA Lithium, 3000 mAh, (optional)		
Battery Life	10+ years expected		
External line-power option ²	Input voltage: 5.0-12.0 V Power jack: 2.1 x 5.5 mm barrel, center positive		
Operating temperature range ³	-18°C to 55°C (0°F to 130°F) - AA Alkaline Batteries -25°C to 60°C (-13°F to 140°F) - AA Lithium L91 Batteries 0°C to 40°C (32°F to 104°F) - US 5V Power Supply 10°C to 40°C (50°F to 104°F) - International 5V Power Supply		
Wireless antenna type	1/4-wave, 20 gauge wire whip, 3.5" (900/868MHz), 7" (433MHz)		
Weight	5.53 oz (157 g) without batteries		

- Hardware cannot withstand negative voltage. Please take care when inserting and removing batteries. Batteries will provide backup power in the case the external power is removed. Operating below 0°C (-32°F) degrees will reduce battery life.

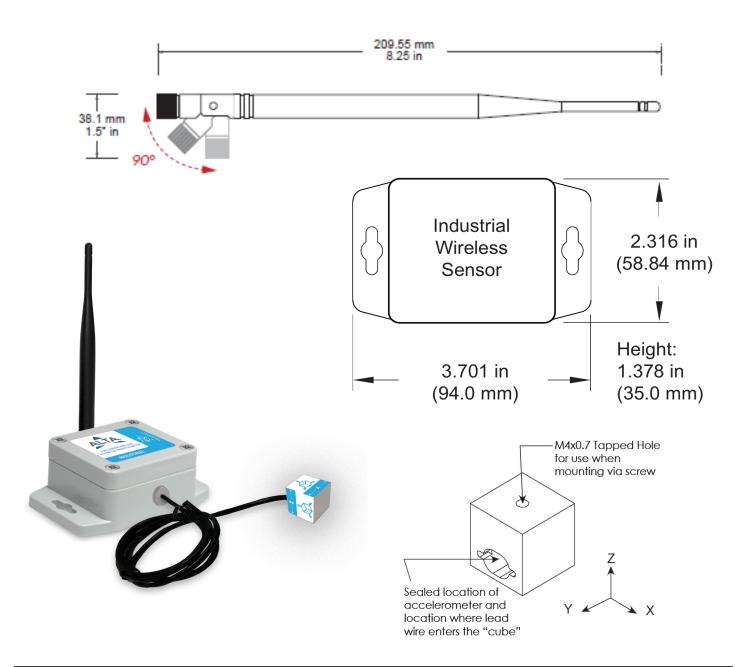

Technical Specifications ALTA® Industrial				
Battery	1x 3.6V AA Lithium Thionyl Chloride, 1500mAh, pre-installed			
Battery Life	10+ years expected			
Operating temperature range (non-leaded measurement range) ¹	-40°C to 85°C (-40°F to 185°F)			
Wireless antenna type	1/2-wave waterproof dipole with RP-SMA connector and swivel neck; dBi of 3.0 (900/868MHz) or 2.5 (433 MHz); length of 8.27" (210mm) (900/868MHz) or 7.68" (195mm) (433 MHz); diameter at thickest point of 0.55" (14mm)			
Weight	4.7 oz. (133 g) with 0.15 m (6.0") lead 5.2 oz. (147 g) with 0.9 m (3.0') lead			
Enclosure rating	IP-65 (dust-proof and waterproof but not submersible) NEMA 1, 2, 4, 4x, 12, and 13 rated, sealed, and weatherproof UL Listed to UL508-4x specifications (File E194432)			

^{1.} Operating below 0°C (-32°F) degrees will reduce battery life.

Commercial-Grade Sensors

Monnit commercial-grade sensors are designed for applications in ordinary environments (normal room temperature, humidity, and atmospheric pressure). Do not use these sensors under the following conditions, as these factors can deteriorate the product characteristics and cause failures and burnout.

- Corrosive gas or deoxidizing gas: chlorine gas, hydrogen sulfide gas, ammonia gas, sulfuric acid gas, nitric oxide gas, etc.
- · Volatile or flammable gas
- · Dusty conditions
- · Low-pressure or high-pressure environments
- · Wet or excessively humid locations
- · Places with salt water, oils, chemical liquids, or organic solvents
- · Where there are excessively strong vibrations
- Other places where similar hazardous conditions exist

Use these products within the specified temperature range. Higher temperatures may cause deterioration of the characteristics or the material quality.

Industrial-Grade Sensors | Type 1, 2, 4, 4X, 12, and 13 NEMA-Rated Enclosure

Monnit's industrial sensors are enclosed in reliable, weatherproof NEMA-rated enclosures. Our NEMA-rated enclosures are constructed for indoor and outdoor use and protect the sensor circuitry against the ingress of solid foreign objects like dust and the damaging effects of water.

- · Safe from falling dirt
- Protects against wind-blown dust
- Protects against rain, sleet, snow, splashing water, and hose-directed water
- · Increased level of corrosion resistance
- Will remain undamaged by ice formation on the enclosure

